



How To

Service Documents from APPI


Document: #HT000060

Document Title: Adjust Ribbon Out Sensor

Product(s): Ti-1000

Procedure:

Important: Make sure you remember the starting position of the VR1 control before adjusting. If the adjustment does not work, return VR1 to the original position.

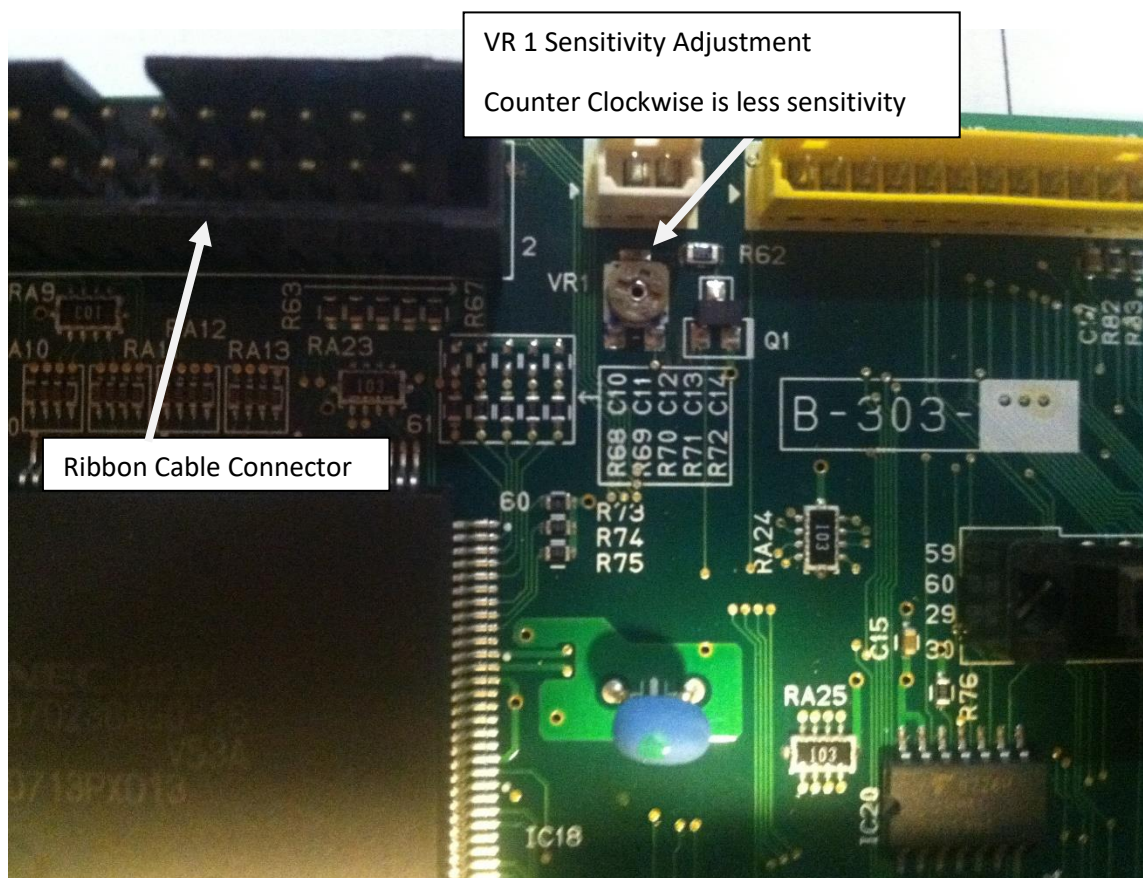

VR 1 Sensitivity Adjustment
Counter Clockwise is less sensitivity

Ribbon Cable Connector

CPU Board



How To

Service Documents from APPI

Your Ribbon Out Sensors may not be working, in which case it will be necessary to replace the sensors. Since it is very difficult to determine which sensor is malfunctioning, APP recommends replacing both sensors.

