

How To Service Documents from APPI

Document: #HT000208


Document Title: Selecting ZDesigner Print Drivers in Labelview Using Reprint Mode

Product(s): Labelview


Procedure:

Open Labelview Software

Create or open existing Label

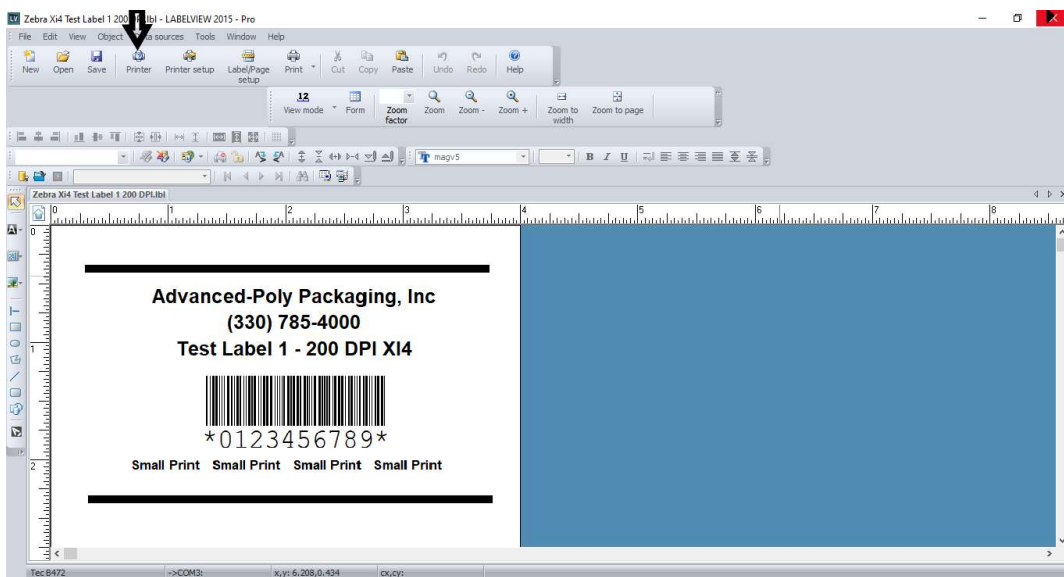

Click on Printer Icon

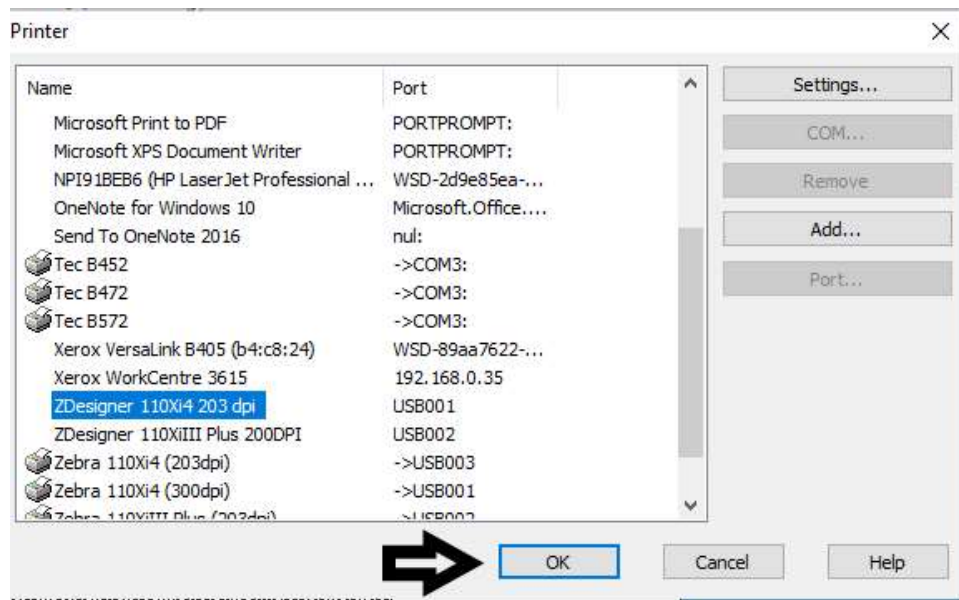


Select the ZDesigner Print Driver that matches your Zebra Printer

ZDesigner 110Xi4 203 DPI or 300 DPI

Or

ZDesigner 110Xi3 203 DPI or 300 DPI

Click OK

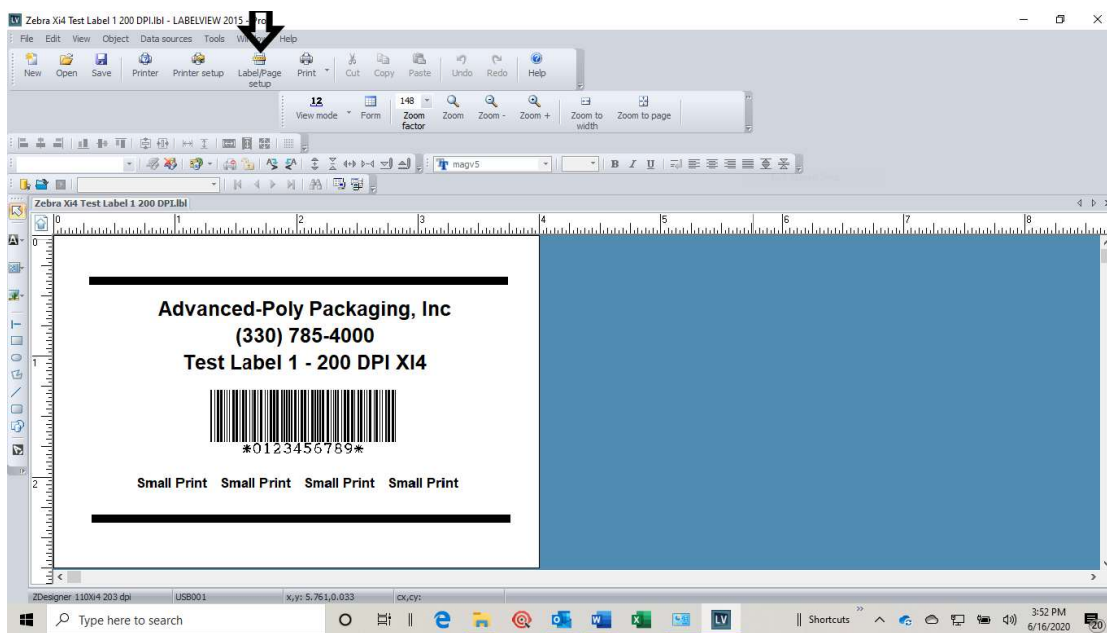

Click on Label/Page Set-up

Label/Page setup

Stock Label Page Margins

Type: Default Type

Name: Default Stock

Number of labels: 1

Label size: 4.000 x 2.750(inches)

Page size: Customized 4.000 x 2.750(inches)

Background: <NONE>

Comment: 1

Preview

Save Remove

Settings... OK Cancel Help

Click on Label Tab

Label/Page setup

Stock Label Page Margins

Label size(inches)

Width: 4.090

Height: 2.000

Corner roundness: 0.000

Number of labels

Per row: 1

Per column: 1

Preview


Settings... OK Cancel Help

The Width cannot exceed the print head width

The Height is Length of the Label


Note: There needs to be ¼” to 3/8” of White Space above the first line of print and below the last line of print

Click on Page Tab

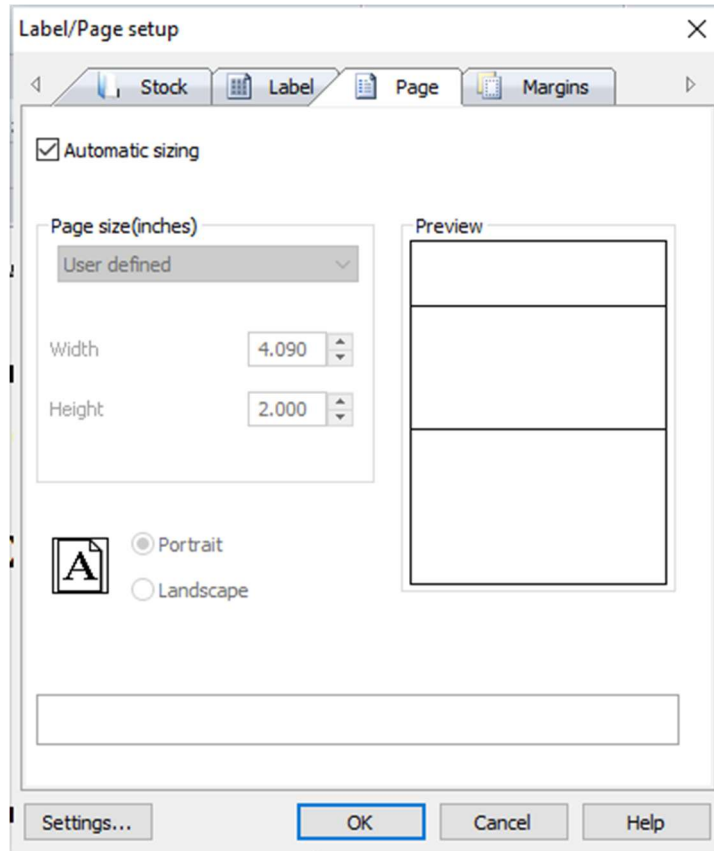


Check the Box Automatic Sizing.

Click on Margins Tab

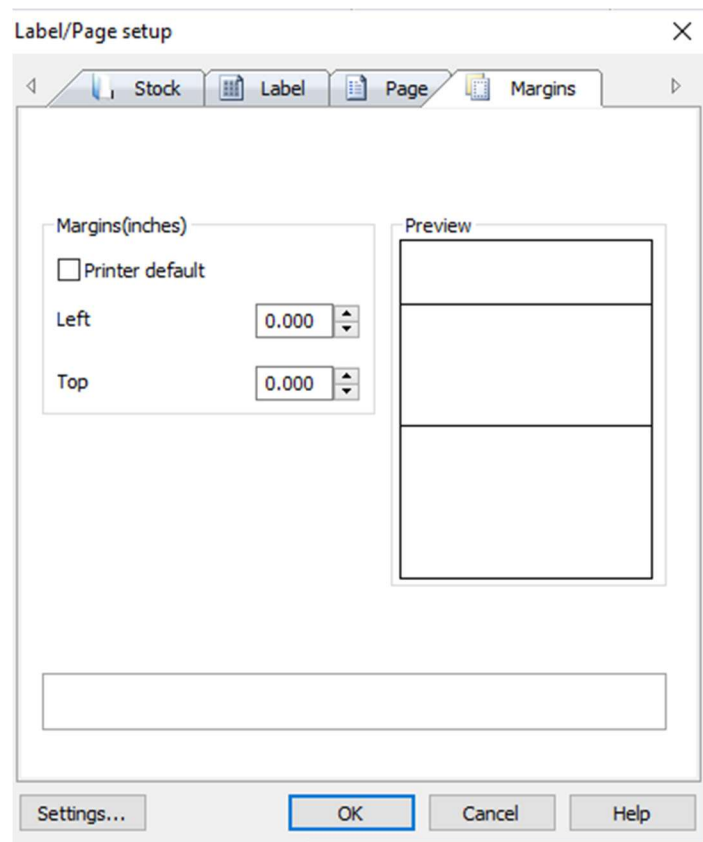


No Margins


Click OK

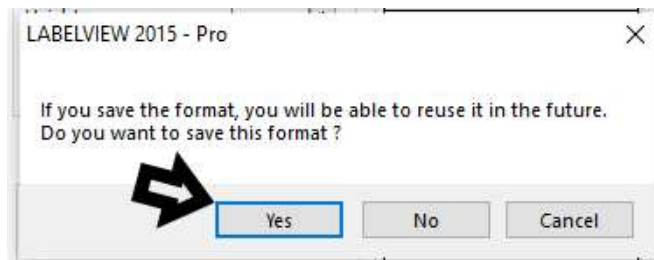


Click Yes

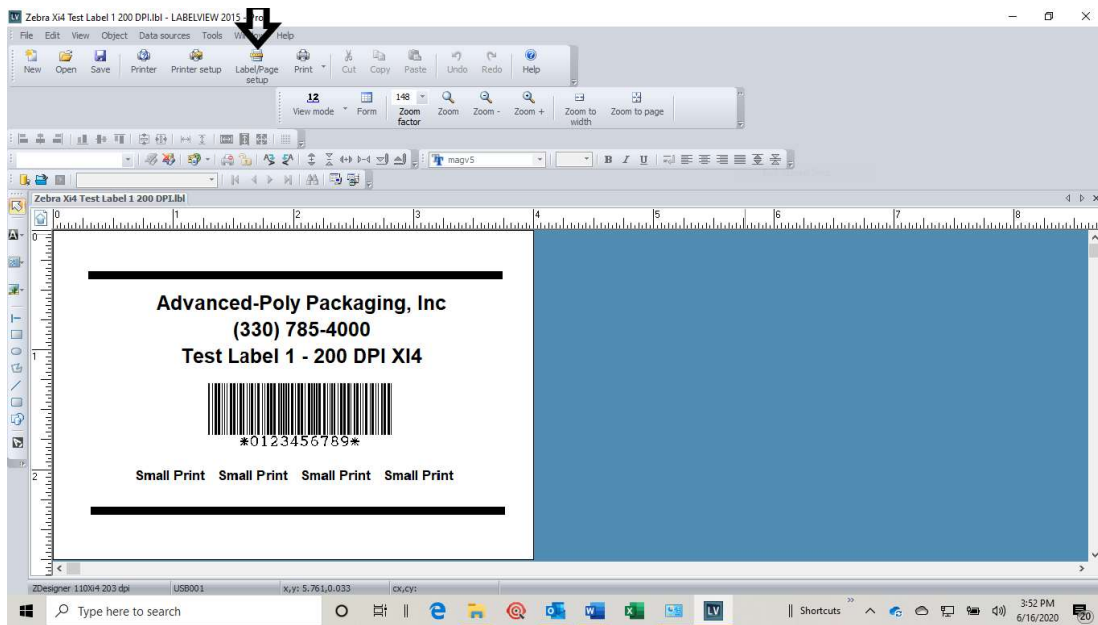

Click on Label/Page Set-up

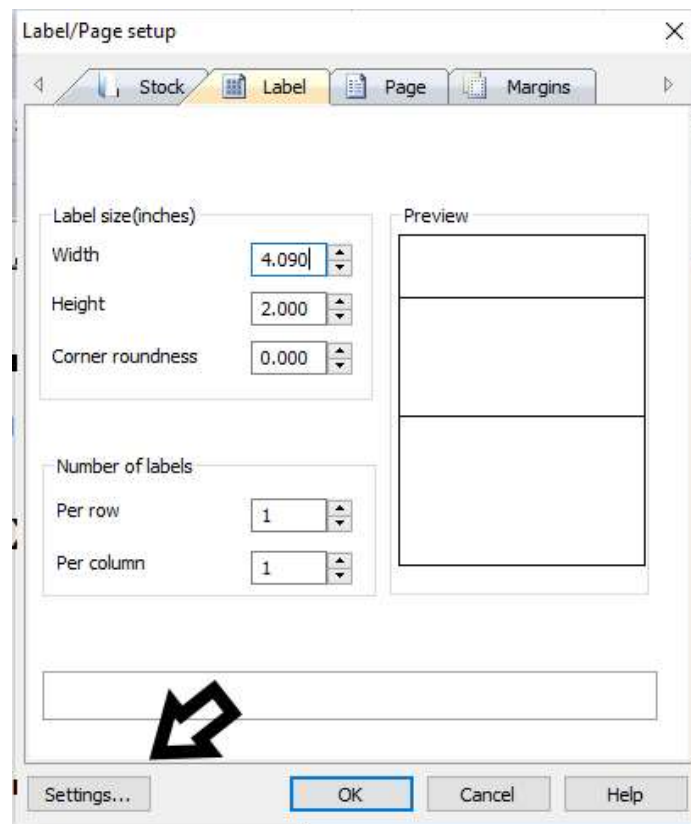

Click on Settings

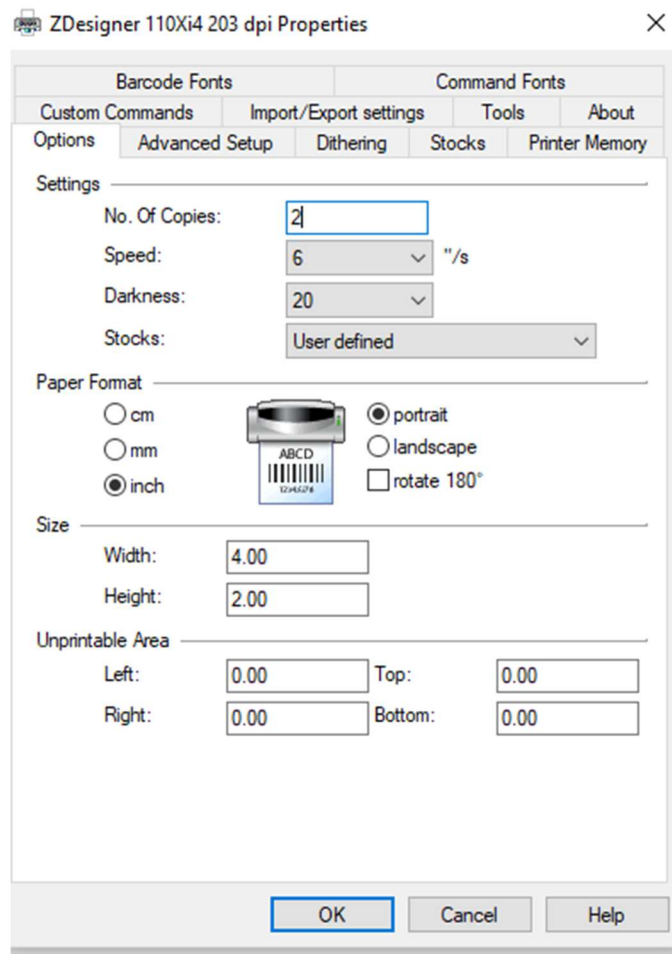


No. of Copies 2
Print Speed 6
Darkness 20
Stock User Defined

Inch
Portrait

Width and Height should be set by the earlier step in Label/Page Set-up

Unprintable Area all 0.00


Click on Advanced Tab

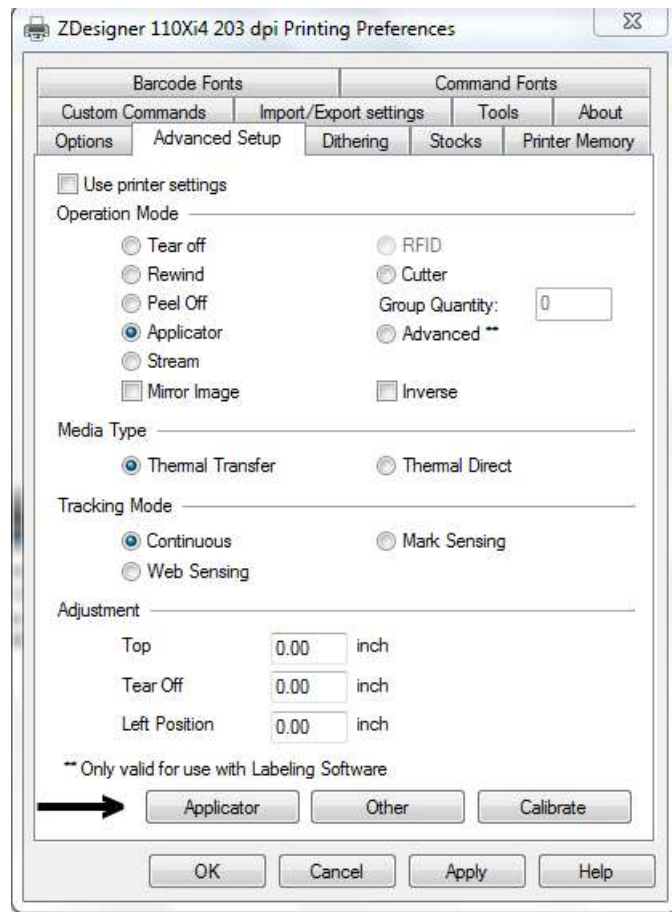

Under Operation Mode check the Circle next to Applicator


The Applicator Button is now live

Click on the Applicator Button

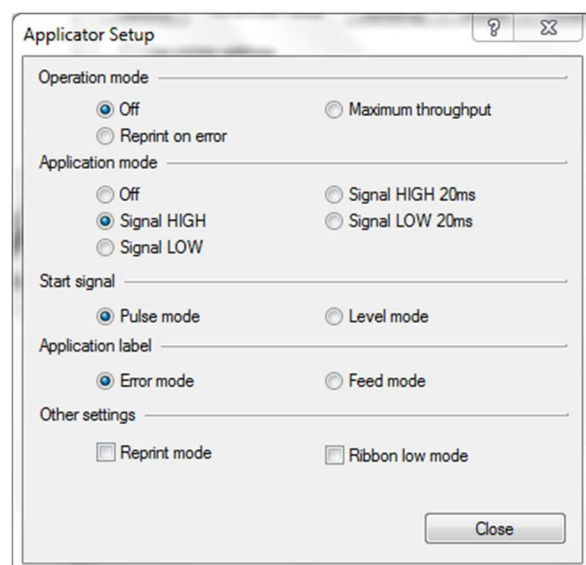

Under Applicator Mode check the Circle next to Signal High

Click Close

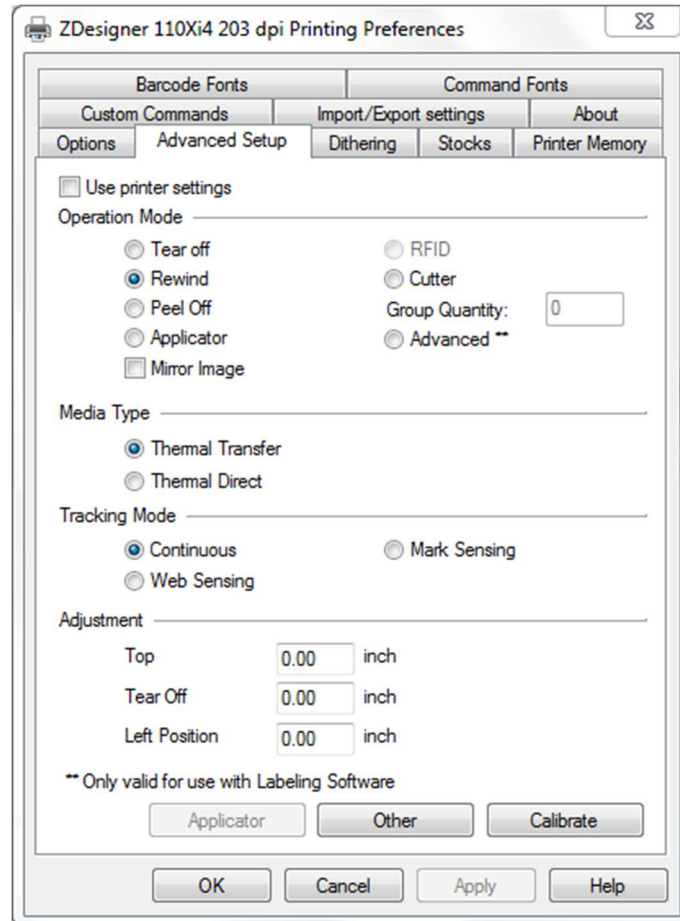


Under Operation Mode check the Circle next to Rewind

Media Type Thermal Transfer

Tracking Mode Continuous

No Adjustments. All 0.00

Click on the Dithering Tab

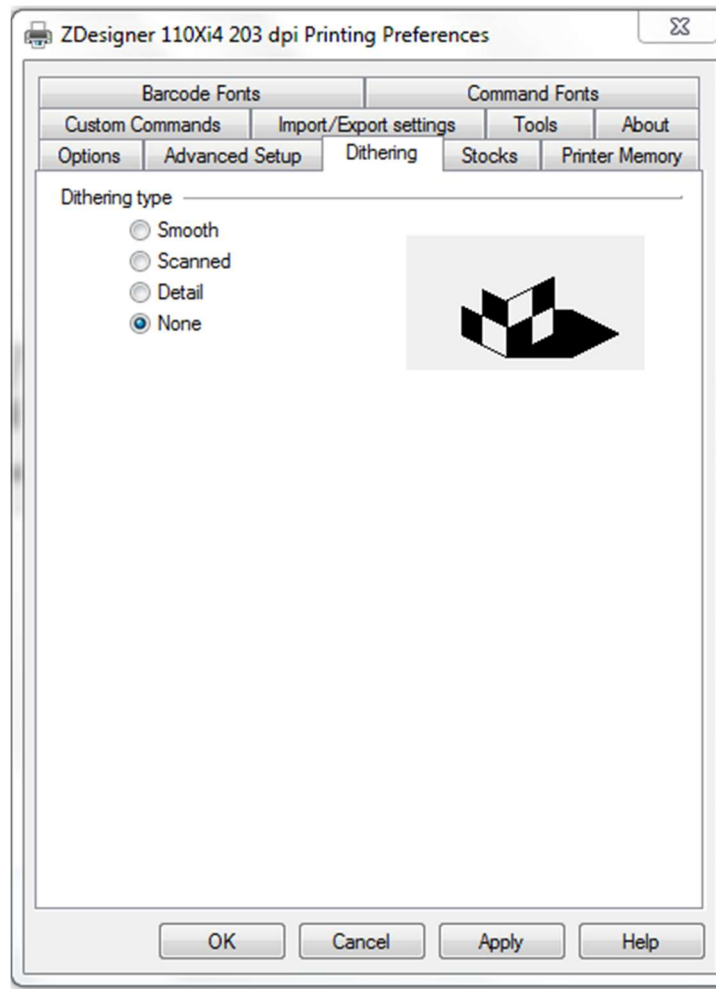

Check the Circle None

Click Apply

Click None